



• SINCE 1918 •

Annual Inspection

Radford Semele Parish Council

Fenced Play Area

Lewis Road, Radford Semele, Leamington Spa,
Warwickshire, CV31 1 UQ



Wicksteed Leisure Limited, Digby Street, Kettering, Northamptonshire, NN16 8YJ

www.wicksteed.co.uk

01536 517028
customerservices@wicksteed.co.uk



Inspection Scope for RPII Inspection Methodology

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Annual Inspectors on the RPII Register of Inspectors when undertaking Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance will follow the requirements and recommendations of BS EN 1176.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to BS EN 1176. We have not assessed these against the requirements of BS EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

- BS EN 15312** Free access multi-sports equipment
- BS EN 14974** Skateparks
- BS EN 16630** Permanently installed outdoor fitness equipment
- BS EN 16899** Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism.

Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	✗
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	✗

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
			Severity>>					
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
			Very Low	Low	Moderate	High	Very High	
			1	2	3	4	5	
			No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			Severity>>					
<p>Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).</p> <p>Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.</p>								

Fenced Play Area

Inspection Ref: 1589724

Site Ref: 87738

Customer Order: 1258518 / 417486

Inspected: 25-February-2022 - 09:07 by Jim Hayes

Risk Assessment: 10 Low Risk



Location:

The site is located in an area of public open space and is overlooked by a number of properties in the local community.

Disabled Access:

Generally accessible; an area accessible to most.

i 4 - Very Low Risk

Item: Fencing - Flat Top
Manufacturer: Unknown
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Multi Play (Toddler)
Manufacturer: Lappset UK Ltd
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 2

Finding 1

There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing - Monitor for any further deterioration and repair as required

Finding 2

There are areas or parts of the timber edging around the playing surface that have rotted - Replace all affected timbers

i 6 - Low Risk

Item: See Saw
Manufacturer: Lappset UK Ltd
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1
 The seesaw seat clearance is less than 230mm in contravention of BS EN 1176 Part 6 - Adjust to provide the correct seat clearance

i 6 - Low Risk

Item: Spring Bird
Manufacturer: Unknown
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 4



Finding 1
 There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers

Finding 3
 The end of handgrips and/or footrests have a cross section of less than 15cm² and fail to meet the requirements of BS EN 1176 Part 6 - Monitor - No remedial work recommended

Finding 2
 There are end caps missing from the item. These are no longer available - Monitor

Finding 4
 There is no identification label affixed to the equipment - Provide an identification label

i 0 - Risk Assessment not Undertaken

Item: Spring Pig
Manufacturer: Unknown
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is no identification label affixed to the equipment - Provide an identification label

i 4 - Very Low Risk

Item: Seat
Manufacturer: Unknown
Surface Type: Tarmac
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

6 - Low Risk

Item: 1 Bay 2 Seat (Cradle)
Manufacturer: Monster Play Systems
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 3



Finding 1
 Slight movement at the frame joints - Monitor

Finding 2
 There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing - Monitor for any further deterioration and repair as required

Finding 3
 The surface has been repaired - Monitor

6 - Low Risk

Item: Spinning Pole
Manufacturer: Lappset UK Ltd
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 2



Finding 1
 The distance between the underside of the roundabout platform and the playing surface is in excess of 110mm and contravenes the requirements of BS EN 1176 Part 5 which requires that the distance be maintained between 60mm-110mm - for the entire circumference of the roundabout - Monitor - No remedial work recommended

Finding 2
 There is no identification label affixed to the equipment - Provide an identification label

i 4 - Very Low Risk

Item: Talk Tubes
Manufacturer: Unknown
Surface Type: Tarmac
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 0 - Risk Assessment not Undertaken

Item: Spinning Pole
Manufacturer: Unknown
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is no identification label affixed to the equipment - Provide an identification label

i 6 - Low Risk

Item: Multi Play (Junior)
Manufacturer: Lappset UK Ltd
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 1



Finding 1
 The firemans pole is less than 350mm from the platform and does not meet with the recommendations of BS EN 1176 Part 1 - Monitor - No remedial work recommended

i 10 - Low Risk

Item: 2 Bay 1 Flat 1 Basket
Manufacturer: Lappset UK Ltd
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 4



Finding 1
 The seat clearance from finished surface level to the underside of the seat is too low when measured in its most onerous position and does not meet the requirements of BS EN 1176 Part 2 - Install seats to a minimum height of 400mm for Group Swing Seats

Finding 3
 There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing - Monitor for any further deterioration and repair as required

Finding 2
 The identification label affixed to the equipment cannot be read - Monitor

Finding 4
 The wetpour playing surface is damaged - Wicksteed are due to repair the surface shortly

 8 - Low Risk	
<p>Item: Site General Manufacturer: Unknown Surface Type: Mixed Surface Item Quantity: 1 Equipment Compliance: N/A Surface Area Compliance: N/A</p> <p>Total Findings: 2</p>	
Finding 1	Finding 2
There is algae or moss growth on the surface resulting in slippery conditions - Clean and treat appropriately	It is recommended that signage, with information including the site address, contact information for maintenance issues and emergency contact details are provided for the facility - Provide in accordance with the recommendations

Findings information

6 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Toddler)
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing
Action: Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Toddler)
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are areas or parts of the timber edging around the playing surface that have rotted

Action: Replace all affected timbers

i 6 - Low Risk (Finding 1)

Item: Rocking Equipment - See Saw
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The seesaw seat clearance is less than 230mm in contravention of BS EN 1176 Part 6

Action: Adjust to provide the correct seat clearance

4 - Very Low Risk (Finding 1)

Item:	Rocking Equipment - Spring Bird	Risk Level:	V - Very Low Risk
Manufacturer:	Unknown	Surface:	Wet Pour




Finding: There is/are bolt cap covers missing or damaged on the item

Action: Replace missing or damaged bolt cap covers

6 - Low Risk (Finding 2)

Item:	Rocking Equipment - Spring Bird	Risk Level:	L - Low Risk
Manufacturer:	Unknown	Surface:	Wet Pour




Finding: There are end caps missing from the item. These are no longer available

Action: Monitor

6 - Low Risk (Finding 3)

Item: Rocking Equipment - Spring Bird
Manufacturer: Unknown

Risk Level: L - Low Risk
Surface: Wet Pour




Finding: The end of handgrips and/or footrests have a cross section of less than 15cm² and fail to meet the requirements of BS EN 1176 Part 6
Action: Monitor - No remedial work recommended

0 - Risk Assessment not Undertaken (Finding 4)

Item: Rocking Equipment - Spring Bird
Manufacturer: Unknown

Risk Level: N - Risk Assessment not Undertaken
Surface: Wet Pour

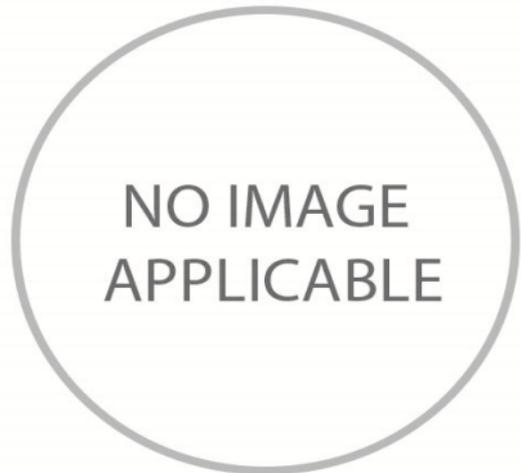

Finding: There is no identification label affixed to the equipment


Action: Provide an identification label

i 0 - Risk Assessment not Undertaken (Finding 1)

Item:	Rocking Equipment - Spring Pig	Risk Level:	N - Risk Assessment not Undertaken
Manufacturer:	Unknown	Surface:	Wet Pour



Finding: There is no identification label affixed to the equipment

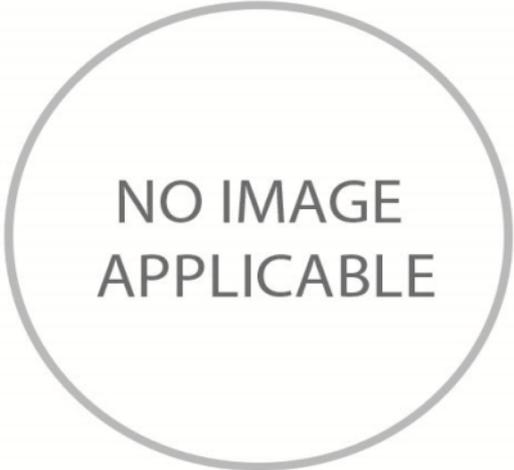

Action: Provide an identification label

i 6 - Low Risk (Finding 1)

Item:	Swings - 1 Bay 2 Seat (Cradle)	Risk Level:	L - Low Risk
Manufacturer:	Monster Play Systems	Surface:	Wet Pour



Finding: Slight movement at the frame joints



Action: Monitor

6 - Low Risk (Finding 2)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Monster Play Systems

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing
Action: Monitor for any further deterioration and repair as required

i 4 - Very Low Risk (Finding 3)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Monster Play Systems

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: The surface has been repaired

Action: Monitor

i 6 - Low Risk (Finding 1)

Item: Rotor Play - Spinning Pole
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour




Finding: The distance between the underside of the roundabout platform and the playing surface is in excess of 110mm and contravenes the requirements of BS EN 1176 Part 5 which requires that the distance be maintained between 60mm-110mm - for the entire circumference of the roundabout

Action: Monitor - No remedial work recommended

i 0 - Risk Assessment not Undertaken (Finding 2)

Item: Rotor Play - Spinning Pole
Manufacturer: Lappset UK Ltd

Risk Level: N - Risk Assessment not Undertaken
Surface: Wet Pour

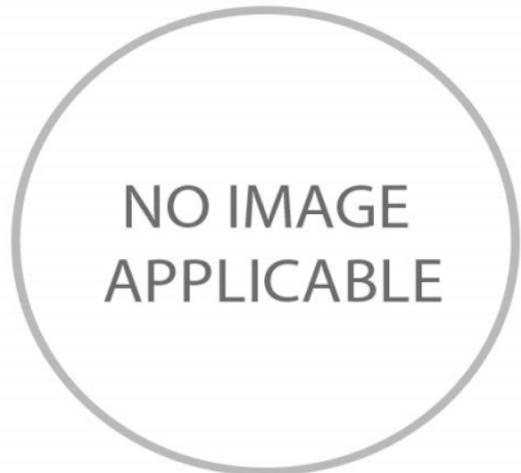


Finding: There is no identification label affixed to the equipment

Action: Provide an identification label

i 0 - Risk Assessment not Undertaken (Finding 1)

Item: Rotor Play - Spinning Pole
Manufacturer: Unknown

Risk Level: N - Risk Assessment not Undertaken
Surface: Wet Pour

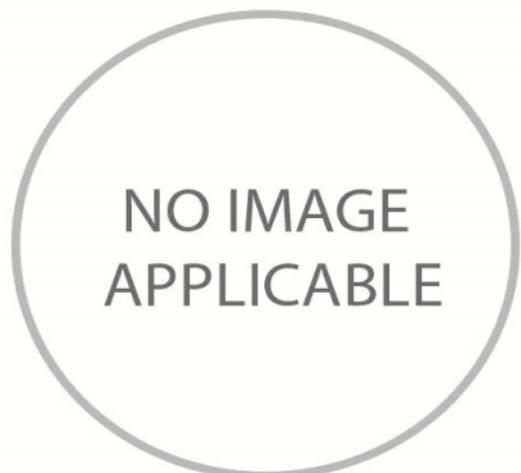

Finding: There is no identification label affixed to the equipment

Action: Provide an identification label

6 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The firemans pole is less than 350mm from the platform and does not meet with the recommendations of BS EN 1176 Part 1

Action: Monitor - No remedial work recommended

10 - Low Risk (Finding 1)

Item: Swings - 2 Bay 1 Flat 1 Basket
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The seat clearance from finished surface level to the underside of the seat is too low when measured in its most onerous position and does not meet the requirements of BS EN 1176 Part 2

Action: Install seats to a minimum height of 400mm for Group Swing Seats

i 0 - Risk Assessment not Undertaken (Finding 2)

Item: Swings - 2 Bay 1 Flat 1 Basket
Manufacturer: Lappset UK Ltd

Risk Level: N - Risk Assessment not Undertaken
Surface: Wet Pour



Finding: The identification label affixed to the equipment cannot be read

Action: Monitor

i 6 - Low Risk (Finding 3)

Item: Swings - 2 Bay 1 Flat 1 Basket
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing
Action: Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 4)

Item: Swings - 2 Bay 1 Flat 1 Basket
Manufacturer: Lappset UK Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The wetpour playing surface is damaged

Action: Wicksteed are due to repair the surface shortly

i 8 - Low Risk (Finding 1)

Item: Ancillary Items - Site General
Manufacturer: Unknown

Risk Level: L - Low Risk
Surface: Mixed Surface




Finding: There is algae or moss growth on the surface resulting in slippery conditions

Action: Clean and treat appropriately

i 5 - Very Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Unknown

Risk Level: V - Very Low Risk
Surface: Mixed Surface

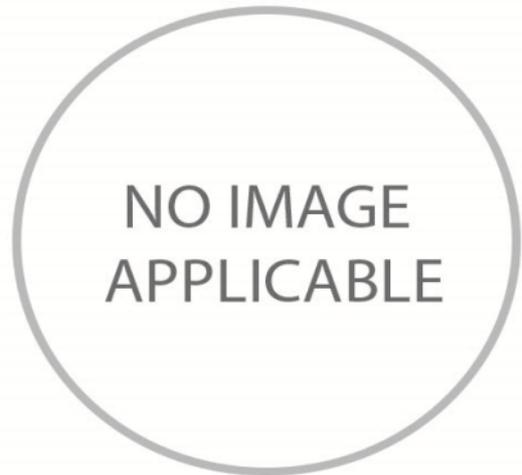

Finding: It is recommended that signage, with information including the site address, contact information for maintenance issues and emergency contact details are provided for the facility

Action: Provide in accordance with the recommendations